

Manhole Inspection Summary

Manhole # S43C__012MH

Printed On: 6/24/2010

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **2) Good**

Record Plat: **43C** Node: **012** Status: **Found**

Insp Date: **3/17/10 11:05 AM**

Incomplete Comments

Crew: **REI2**
Inspector: **Provine, D**
Firm: **JV**

Location Address: **Bethel ST.**

Cross Street: **Lanley St.**

Manhole Type: **Junction**

Location: **Roadway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments **Pass**

Cover

Shape: **Circular**

Diameter: **30** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame

Offset: **0** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

Chimney / Frame Adjustment

☒ Exists Material: **Brick**

☐ Parged Height: **10** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Loose Brick** ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel

Material: **Concrete**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel

Material: **Concrete**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench

☒ Exists Material: **Brick**

☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps

Count: **8** Missing: **0** ☐ Corroded

Surcharge

☐ Evidence Of Surcharge

Depth:

(ft.)

☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S43C__012MH


Printed On: 6/24/2010

Page 2 of 4

Location View



Location View

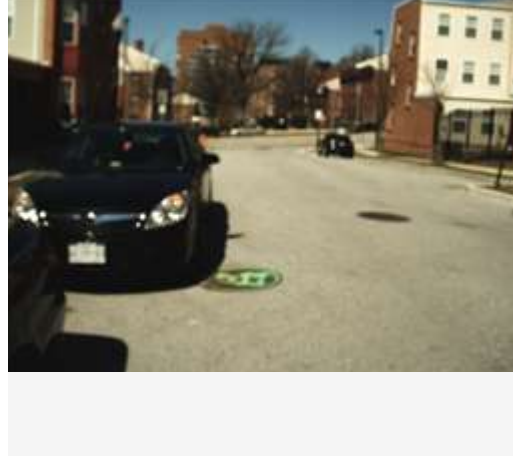

Top View



Defect 2



debris

Defect 1



frame leaks

Manhole Inspection Summary

Manhole # S43C__012MH

Printed On: 6/24/2010

Page 3 of 4

8 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **12** (in.) Rod and Bar (Angled)
Pipe Material: **PVC** ☐ Pipe Lined
Invert Depth: **12.33** (ft.) Flow Characteristics: **Fast**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

6 in. Circular Gravity Sewer
Pipe In @ 5 O'Clock

5 O'Clock Inflow

Drop In @ 5 O'Clock



Pipe Height: **9.6** (in.) Rod and Bar (Angled)
Pipe Material: **PVC** ☐ Pipe Lined
Invert Depth: **11.75** (ft.) Flow Characteristics: **Slow**
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease
Silt Depth: (in.) Deposits Extent:
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **House connection / Service line**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S43C__012MH

Printed On: 6/24/2010

Page 4 of 4

8 in. Circular Gravity Sewer
Pipe In @ 9 O'Clock

9 O'Clock Inflow



Pipe Height: **14.4** (in.) Rod and Bar (Angled)

Pipe Material: **PVC** ☐ Pipe Lined

Invert Depth: **10.00** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None**

Pipe Seal Cond: **Sound**

Drop: Outside	Rod and Bar
Angled: Yes	Reading: 11.42 (ft.)
	Inv Depth: 12.42 (ft.)
Drop Condition: Open	

Connects To: **Connecting Node Not Available**

☐ Possible Illicit Connection